

## S5000 TECHNICAL BULLETIN

Date	18/05/22
Topic	Steering Rack Clamp Bolt
Priority	High



### PROBLEM:

At the AGP in R3 we had a steering rack mount bolt strip the thread in the chassis bulkhead insert causing the rack to come loose and the car to DNF the race.

Upon inspection it was found that the 4x bolts (item 7, highlighted yellow below) were M8 SHCS 90mm Long with insufficient thread engagement.

### SOLUTION:

Ensure M8 SHCS 100mm Long bolts are used in this application. Check all cars and replace if needed.

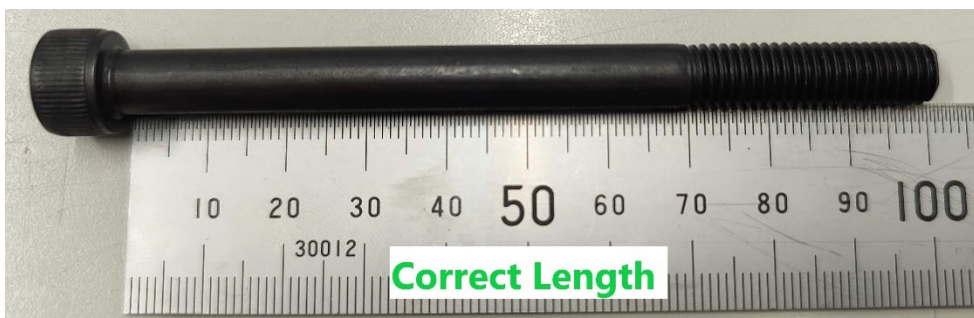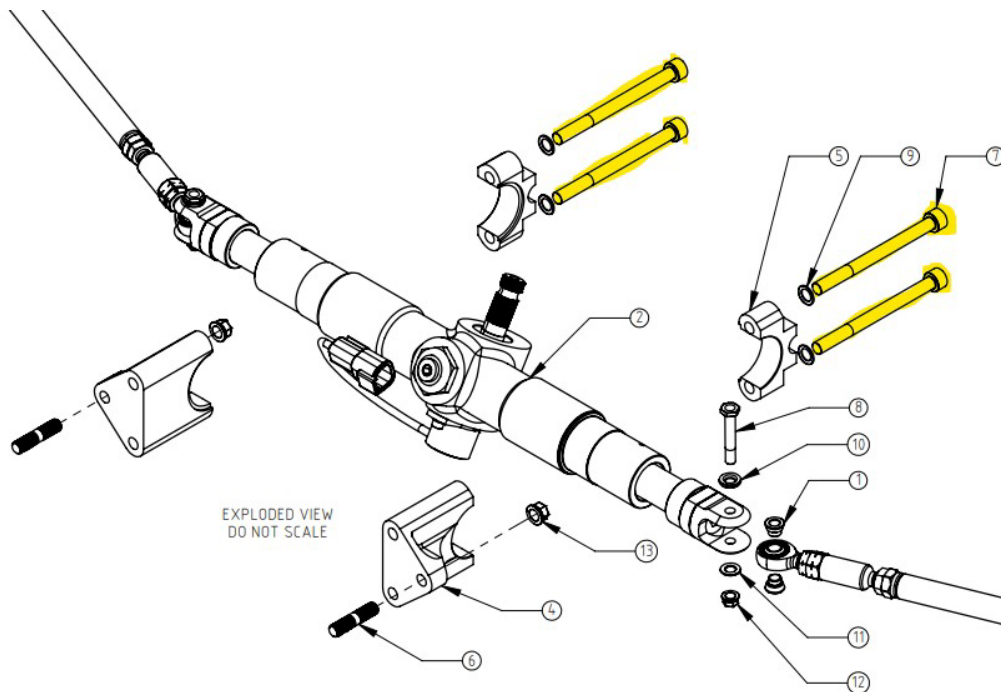

Any questions please contact [s5000@grmotorsport.com.au](mailto:s5000@grmotorsport.com.au)